# 718 Static Sensor Installation, Operation and Maintenance

勝 特 力 材 料 886-3-5753170 胜特力电子(上海) 86-21-34970699 胜特力电子(深圳) 86-755-83298787 Http://www.100y.com.tw

United States of America



Figure 1. (Left to right) SCS <u>718</u> Static Sensor and SCS <u>718A</u> Air Ionizer Test Kit.

#### Description

The SCS Static Sensor 718 is a portable handheld instrument used for locating and measuring electrostatic charges. It can be used to locate ESD trouble-areas, and is a valuable tool for the ESD-control engineer. Used in conjunction with the SCS Air Ionizer Test Kit 718A (sold separately), it can be used for verification and auditing of air ionizers. The Static Sensor 718 is battery-powered and has several measurement features:

**Range:** measurements can be taken in a 0 to  $\pm 1.999$  kV or 0 to  $\pm 19.99$  kV range.

**Automatic Zero:** push button feature allows easy adjustment to zero. No screws or dials to turn.

**HOLD function**: allows the User to "freeze" a displayed measurement, for later evaluation.

Automatic shutoff: conserves battery power by shutting off the instrument after 20 minutes of inactivity.

#### **Power Requirements and Battery Installation**

- Both the Static Sensor 718 and SCS Charger 718A use a 9V alkaline battery.
- 2. To install the battery on either unit:
- Remove the battery cover, located in the lower back of the unit. To do this, press down on the cover and slide it downward.
- Pull the battery connector out of the housing, and align the male/female ends of the connector with the proper terminals on the battery.
- Connect the two and place the connected battery into the housing by inserting the connector end first, then following up with the other end of the battery.
- 6. Replace the cover.

- 7. The SCS Static Sensor 718 has a Low Battery indicator. Once the battery is depleted to approximately 6.5 volts, the instrument will show BAT in the display. At this time, the Static Sensor 718 will not produce accurate results and the battery should be replaced.
- 8. The SCS Charger 718A also has a low battery indicator. This is an LED located at the left-hand side of the unit. When the battery voltage drops below operating level, the LED will light up. At this time, the user shouldreplace the battery. Usage of the Charger 718A under low battery conditions would lead to insufficient voltage levels being generated.



Figure 2. SCS <u>718</u> and <u>718A</u> Battery Replacement and Indicators.

### **Operation of the Static Sensor 718**

For accurate measurements during usage, it is recommended that the outside housing of the Static Sensor 718 be connected to an electrical ground. This can be accomplished by having the user holding the instrument connected to ground through either a static control wrist strap, or while wearing static control footwear. The enclosure of the Static Sensor 718 is made of conductive plastic and is, therefore, electrically connected to whomever is holding the instrument. In addition, ground for the instrument can be provided through the Voltage Monitor Output on the front of the case.

The SCS Static Sensor 718 is a precision electronic instrument. Improper use or rough treatment can damage the unit, and render it incapable of providing accurate measurements.

**Turning the unit ON and OFF:** To turn on the Static Sensor 718, momentarily press down on the membrane switch labeled POWER. Determining that the power is on can be verified by seeing that the liquid crystal display (LCD) is on, and that the red light-emitting diodes in the front of the sensor are lit.

SCS - 926 JR Industrial Drive, Sanford, NC 27332 • (919) 718-0000 • Website: StaticControl.com

To shut off the Static Sensor 718, momentarily press down on the membrane switch labeled POWER. Determining that the power is off can be verified by seeing that the liquid-crystal display (LCD) is off.

Making Electrostatic Voltage Measurements: hold the instrument 1-inch (2.54 cm) away from the object being measured. The display will update with the voltage measurement in kilovolts. If the measured voltage is greater than the measurement range of the instrument, a -1. Will be displayed. At this time, switch to a greater range. If over-ranging occurs even with the high range activated, the static charge on the object cannot be measured with the Static Sensor 718.

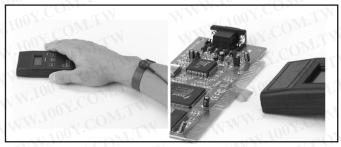


Figure 3. Using 718 Static Sensor to take measurements.

**Measurement Range:** all measurements are in kilovolts (kV) as stated on the front label of the unit. The Static Sensor 718 has two measurement ranges: 0 to ±1.999 kV and 0 to ±19.99 kV. The unit's current measurement range mode can be verified by checking the display. Three digits following the decimal point indicate that the unit is in 0 to ±1.999 kV range. Two digits following the decimal point indicate that the sensor is in 0 to ±19.99 kV range. To change between measurement ranges, press the RANGE/HOLD button once, momentarily.

**HOLD Function:** in the event that the user wishes to freeze the current measurement, the HOLD function of the Static Sensor 718 may be used. Simply press the HOLD switch momentarily and the currently displayed voltage will be frozen. A HOLD notice will also be displayed to alert the user that the instrument is currently in HOLD status. To unfreeze the display and return to floating measurement, momentarily press the HOLD switch once again.

Note: During HOLD condition the distance indicating LED's are turned off.

**Zero Adjustment:** the SCS Static Sensor 718 has a zero adjustment function, which sets a zero reference point for all subsequent measurements. This zero reference can be set by pointing the instrument at a

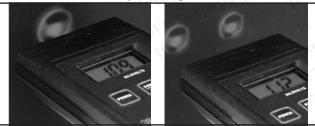


Figure 4. <u>718</u> Static Sensor showing hold function and floating measurement function.

known zero-voltage surface, and holding down the RANGE/ZERO button for longer than 3 seconds. After 3 seconds, the display will flash and adjust to zero. Repeat this step for both the low and the high ranges. The zero adjustment should be performed every time the unit is turned on.

Measurement Accuracy: Distance Indicator: the Static Sensor 718 is factory calibrated to give accurate measurements when it is placed one inch (2.54 cm) away from the object to be measured. To assist the user in gauging this distance, two light-emitting diodes (LED's) are present on the front face of the instrument. These LED's emit two red, bull's-eye targets on the surface of the object being measured. As the instrument gets closer to the one inch measurement distance, the bull's-eyes begin to converge. When they converge and become one, the instrument is approximately one inch away, and the measurement can be made. For more accurate measurements, it is recommended that the user manually measure the distance between the front housing of the instrument and the object being measured.

Accuracy and Size of Object to be Measured: the minimum surface area on an electrostatically charged object which can be accurately measured is a 5 square inch (32.3 cm²) area.

Measurements from Greater than One Inch (2.54 cm) Away: in the event that a one inch separation between object-to-be measured and the Static Sensor 718 cannot be achieved, it is possible to get approximate readings.

Continuous Output: an output jack is provided on



Figure 5. 718 Static Sensor has a continuos output range.

the front of the SCS Static Sensor 718. This output can be used to feed a continuous signal into a data storage device for continuous monitoring of measured voltages. Please use a 3/32 inch (2.5 mm) mono-phone plug to connect into the output jack. The output signal is dependent on the measurement range currently selected. For the low range, the output signal is 1/1000 of the measured electrostatic voltage. For the high range, the output signal is 1/10,000 of the measured voltage.

SCS - 926 JR Industrial Drive, Sanford, NC 27332 • (919) 718-0000 • Website: StaticControl.com

Automatic Shut-Off: the Static Sensor 718 will automatically shut-off 20 minutes after the last switch activity. This is done in order to conserve battery power. In the event that the user needs to have the unit stay ON continuously, when turning the unit on press the POWER AND RANGE switches simultaneously. This deactivates the Automatic Shut-Off feature. The BAT indicator will then flash three times to indicate that the automatic shut-off features has been disabled. The Automatic Shut-Off feature will reset itself the next time the instrument is turned on.

# Operation and Use of SCS Air Ionizer Kit 718A

It is recommended that the user be familiar with ionizer test standards ANSI/ESD S3.1 and draft standard ANSI/ESD SP3.3 if the Air Ionizer Test Kit 718A is used to perform verification testing on ionizer performance.

**Assembly:** slide the charge plate over the Static Sensor 718 until it stops. The charge plate slides onto the lower groove, on the sides of the Static Sensor 718.



Figure 6. 718 Static Sensor charging plate in use.

Charging the Plate: holding the Static Sensor 718 (with charge plate attached) in one hand, use the other hand to touch the probe of the SCS Air Ionizer Test Kit 718A to the charge plate. Press either the + button (for a positive voltage) or the – button (for a negative voltage), then remove the probe from the charge plate. Be sure to keep the button pressed while removing the probe from the charge plate. The display on the Static Sensor 718 will indicate a positive or negative charging voltage (1.1kV minimum). If a voltage of less than ±1.1kV is displayed, check to see if the low battery indicator on the SCS Charger 718A is illuminated. If illuminated, replace the battery in the charger. If the unit continues to supply an incorrect voltage to the charge plate, please contact SCS for additional instructions. Testing ionizer discharge time: after charging the plate. hold the SCS Static Sensor 718 approximately one foot (30.5 cm) away from the ionizer. Monitor the display to see how quickly the 1.1 kV charge is dissipated to 0.1 kV. The speed at which this occurs (the discharge time) indicates how well the ionizer is operating. Please refer to the specific ionizer's operating manual or consult with the ionizer manufacturer to determine what this discharge time should be. Repeat this procedure for both a positively and a negatively charged plate.



Figure 7. Testing Ionizer Offset Balance.

**Testing Ionizer Discharge Time:** after charging the plate, hold the SCS Static Sensor 718 approximately one foot (30.5 cm) away from the ionizer. Monitor the display to see how quickly the 1.1 kV charge is dissipated to 0.1 kV. The speed at which this occurs (the discharge time) indicates how well the ionizer is operating. Please refer to the specific ionizer's operating manual or consult with the ionizer manufacturer to determine what this discharge time should be. Repeat this procedure for both a positively and a negatively charged plate.

Testing ionizer offset balance: zero the charge plate by touching it with a grounded object. This can either be the finger of a grounded person or some other item which is connected to electrical ground. In either case, zeroing the charge plate should make the display on the Static Sensor 718 read zero. Hold the Static Sensor 718 approximately one foot (30.5 cm) in front of the ionizer. Monitor the display. The value displayed is the offset balance of the ionizer, which is the difference between the number of positive and negative ions being emitted. Please refer to the specific ionizer's operating manual or consult with the ionizer manufacturer to determine what this offset balance should be.

#### Service/Calibration

Service and Repair: in the event that you believe the Static Sensor 718 or the SCS Air Ionizer Test Kit 718A is in need of repair, please contact your local SCS representative for troubleshooting help, and, as needed, repair information. There are no user-serviceable parts on either product.

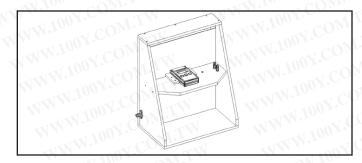


Figure 8. 718 Static Sensor on test fixture.

SCS - 926 JR Industrial Drive, Sanford, NC 27332 • (919) 718-0000 • Website: StaticControl.com

Calibration: the SCS Static Sensor 718 and SCS Air Ionizer Test Kit 718A products are supplied by the factory pre-calibrated. SCS does not specify a minimum calibration cycle for the Static Sensor 718 or Air Ionizer Test Kit 718A products. The user, usually according to internal Quality procedures, determines calibration cycles. In the event that the user wishes to perform a self-calibration, the following steps should be followed for the Static Sensor 718 (user-calibration not possible on the Air Ionizer Test Kit 718A).

**Equipment Needed:** Test Fixture High-Voltage Power Supply, capable of supplying voltages up to 10,000V. Voltmeter, with > 50 kilohms input impedance, capable of measuring voltages down to the uV range. Cable with a 3/32 inch (2.5 mm) mono plug and secondary connector to interface with voltmeter.

**Test Fixture:** Metal plate of at least 5 square inches area (38.7 cm<sup>2</sup>) area. Metal stand capable of supporting Static Sensor 718, and holding it one inch (2.54 cm) away from the metal plate, centered. Connectors on the plate with which it can interface with the high voltage power supply. Connections on the metal stand with which it can be connected to electrical ground.

Procedure: Place the Static Sensor Static Sensor 718 on the metal stand. Verify that it is exactly one inch (2.54 cm) away from the metal plate, and that its position is centered relative to the plate. Connect the stand to ground. Turn on the Static Sensor 718 and set it to the low range. Ground the plate. Zero the display. Remove the ground from the plate, and connect it to the high voltage power supply. Apply a 1 kV charge to the plate.

The instrument should now be reading 1.000. If it is not, remove the battery door and use a screwdriver to turn the small screw located inside the battery compartment. Use a small screwdriver to turn the small screw, located on the front right side of the instrument. This screw should adjust the reading on the display. Once the display has been adjusted to read 1.000, the low range of the SCS Static Sensor 718 is now calibrated. Repeat procedures 5.5.2 - 5.5.6 for the high of the meter, using a test voltage of 5,000 volts.



Figure 9. 718 Static Sensor adjustable screw for display.

## **SCS Static Sensor 718 Specifications** (All values typical)

(At 1in. (2.54cm) distance from sensor to target)

**Dimensions** 0.85" H x 2.4" W x 4.2" L

2.2 cm H x 6.1 cm W x 10.6 cm L

4.4 oz. (125 g) with battery Weight

Operating 41° F - 95° F (5° C - 35° C) Conditions Up to 80% RH, non-condensing

Indoor use only

For use at altitudes below 6,562 ft.

(2,000 m).

Pollution Degree II Class III

Enclosure Conductive Housing

Power 1 - 9 volt alkaline battery

Requirements

Measurement Low Range: 0 to ±1.999 kV / inch High Range: 0 to ±19.99 kV / inch Ranges

Voltage Display Liquid Crystal Display

Display 1V/inch (0.39V/cm) @ low range 10V/inch (3.9V/cm) @ high range Resolution

+ 10 counts

3/32 in. (2.5 mm)mono phone Voltage Output

Tip: signal Sleeve: ground

1/1000 of measured Voltage Output

voltage @ low range 1/10,000 of measured voltage @ high range

Automatic Shutoff 20 minutes after last switch activity

Distance Indicator LED targets. Aligned targets

> indicate 1in. (2.54 cm) measurement distance.

Measurement Stability

± 10 counts

cULus, CE Certifications

> 勝 特 力 材 料 886-3-5753170 胜特力电子(上海) 86-21-34970699 胜特力电子(深圳) 86-755-83298787

Http://www.100y.com.tw

SCS - 926 JR Industrial Drive, Sanford, NC 27332 • (919) 718-0000 • Website