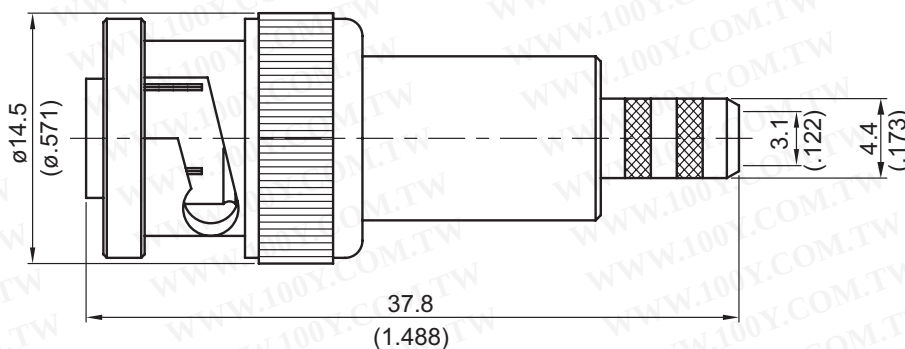


MHV3100-0058

MHV Plug Crimp

50Ω



Parts	Material	Plating(Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Gold 5 Over Nickel 50 Over Copper 50
Gasket	Silicon	
Spring	SK5	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 13.26 g


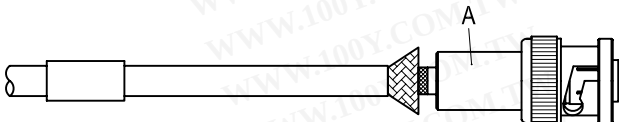
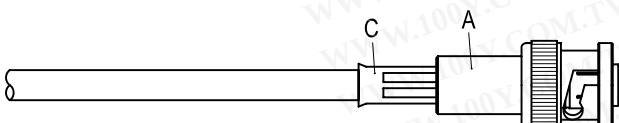
Suitable Cables: RG58, JBY195

This part number complies with RoHS.

Notice: JYEBao reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

MHV3100-0058		DATE	2016/08/22	REV	—
A B C    BODYCONTACT PINFERRULE					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE "C" OVER CABLE. Step 3: PUT PIN "B" ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN "Y". (USE SQUARE 1.6mm/0.063inch SECTION OF INSERT-B IF CRIMPED)		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR "A" IN PLACE.		
			Step 5: SLIDE FERRULE "C" TOWARDS THE CONNECTOR "A" AND CRIMP. (USE 5.5mm/0.217inch HEX SECTION OF INSERT-B)		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	