

勝 特 力 材 料 886-3-5753170 胜特力电子(上海) 86-21-34970699 胜特力电子(深圳) 86-755-83298787 Http://www.100y.com.tw **DIGITAL PRESSURE SENSOR**

DP-100 SERIES



UL recognition pending

A New Global Standard

Dual display for the digital pressure sensors of the future



Industry first. Dual 3-color display makes operation easier!

The dual display means that the 'current value' and the 'threshold value' can be displayed at the same time to improve ease of operation and visual checking.

Introducing a new standard in digital pressure sensor technology.

* As of November 2005 and based on research conducted by SUNX for 30 mm 1.181 in square sized digital pressure sensors.

A new global standard

'Current value' and 'threshold value' can be checked at the same time!


Dual display allows direct setting of threshold value

Equipped with a 30 mm 1.181 in square compact-sized dual display. Because the current value and the threshold value can be checked at the same time, the threshold value can be set and checked smoothly without having to switch screen modes. ON / OFF operations are still carried out while the threshold values are being set, so setting to the same sensitivity as dial control-type sensors is possible. And naturally a key lock function is also equipped.



3-color display (Red, Green, Orange)

The main display changes color in line with changes in the status of output ON / OFF operation, and it also changes color while setting is in progress. The sensor status can therefore be understood easily, and operating errors can be reduced.

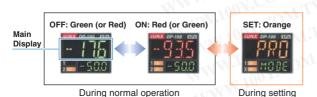

1 8888 2 8888



Readable digital display!

12 segments are used and an alphanumeric display has been adopted. This improves visual checking of letters and numbers.

Dual Display Direct setting



Copy function lets work be carried out accurately and quickly


Copy function reduces man-hours and human error

Sensors can be connected to a master sensor one by one, and a copy of the setting details for the master sensor can be transmitted as data to the other sensors. If making the same settings for multiple sensors, this prevents setting errors from occurring with the other sensors and also reduces the number of changes required to instruction manuals when equipment designs are changed.

Setting details can be copied.



Advantage Setting man-hours are reduced and sensor setting time is shortened.

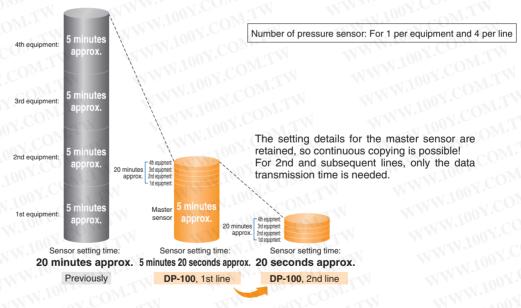

Advantage


Human operating error is reduced.

- Because all details are copied automatically, it prevents problems occurring as a result
 of human error.
- Instruction manuals can be updated easily when changes occur to equipment design!

Setting is smooth and easy




The setting levels are clearly separated into 'RUN mode' for operation settings that are carried out daily, 'MENU SETTING mode' for basic settings, and 'PRO mode' for special and detailed setting. These make setting operations easy to understand and easy to carry out.

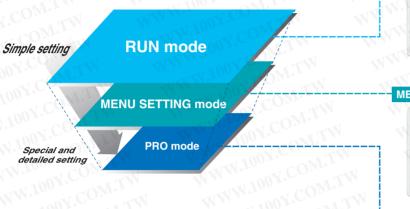

Settings such as threshold value adjustment and key lock operation can be carried out while the sensor is operating.

switching can be carried out.

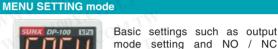




RUN mode

High-level function settings such as hysteresis adjustment and the copy function can be carried out.

Display is orange while setting is in progress

The display appears in red and green during RUN operation, but it changes to orange while setting is in progress, so that the sensor status can be viewed at a glance.

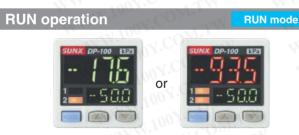


Red or green when output is ON / OFF

While setting MENU SETTING mode PRO mode

Orange while setting is in progress

Default settings that can be used straight away

Easy-to-use default settings are provided for applications that are used frequently by pressure sensors. The default settings for low pressure types are ideal for suction checking applications, and those for high pressure types are ideal for checking reference pressure.

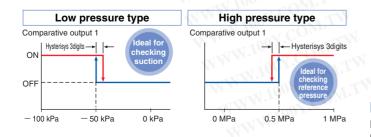

Buttons with good clicking touch

The buttons have a good clicking touch, allowing smooth setting.

The clicking feeling is transmitted even through gloves.


Reset function

If a problem ever occurs with the sensor settings, they can be returned to the default settings.

Full range of performance and functions in a compact body

All models in the line-up are compound pressure types

No sensor settings are required to switch between positive pressure and negative pressure, so that the number of registered part numbers can be decreased.

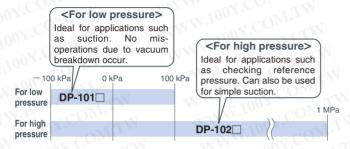

Realizes high performance Low pressure type

The low pressure type displays measurements in 0.1 kPa at a resolution of 1/2000 and has a response time of 2.5 ms (variable up to 5,000 ms), ± 0.5 % F.S. temperature characteristics and ± 0.1 % F.S. repeatability, giving it high performance.

Resolution: 1/2,000 Response time: 2.5 ms

Temperature characteristics: ±0.5 % F.S.

Repeatability: ± 0.1 % F.S.




Displays measurements in 0.1 kPa


Equipped with independent dual output Standard type

Equipped with two independent comparative outputs, and separate sensing modes can be selected for each of them. One of the comparative outputs can even be used for alarm output. In addition, if an output is not being used, it can be disabled.

 Vacuum breakdown can also be checked during suction applications!

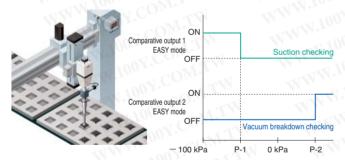


 Reference pressure alarm output is possible during reference pressure checking!

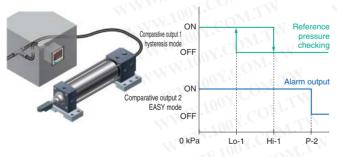

Three output modes are suitable for a wide range of applications

EASY mode


This mode is used for comparative output ON / OFF control.

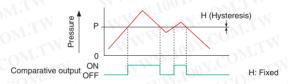

Notes: 1) Hysteresis can be fixed to one of eight different levels. 2) ' p- { 'appears in the sub display for comparative output 1, and ' P-2' appears for comparative output 2.

Hysteresis mode


This mode is used for setting comparative output hysteresis to the desired level and for carrying out ON / OFF control.

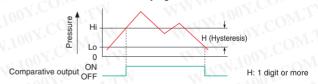

Note: ' \mathcal{H}_{r} - f ' or ' L_{Ω} - f ' appears in the sub display for comparative output 1, and 'H, -2' or 'Lo-2' appears for comparative output 2.

Window comparator mode


This mode is used for setting comparative output ON and OFF at pressures within the setting range.

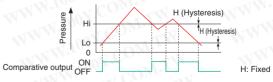

Notes: 1) Hysteresis can be fixed to one of eight different levels. 2) ' \dot{H}_{i} - l 'or ' \underline{l}_{α} - l 'appears in the sub display for comparative output 1, and ' \dot{H}_{i} - \ddot{c} 'or ' \underline{l}_{α} - \ddot{c} 'appears for comparative output 2.

Switching is possible between analog voltage output and external input Multi-function type


Multi-function type is available that allows selection of analog voltage output or external input (auto-reference / remote zero-adjustment). This is suitable for multi-specification applications.

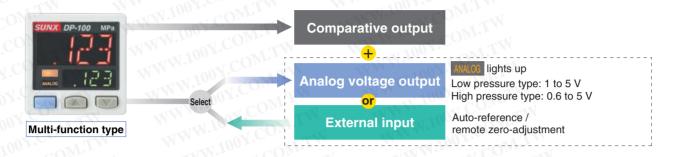

Equipped with auto-reference / remote zero-adjustment functions Multi-function type More precise pressure management is possible with a minimum of effort

If the reference pressure of the device changes, the autoreference function partially shift comparative the output judgment level by the amount that the reference pressure shifts, and the remote zeroadjustment function can reset the display value to zero via external input. These functions are ideal for places where the reference pressure fluctuates wildly, or where fine settings are desired.



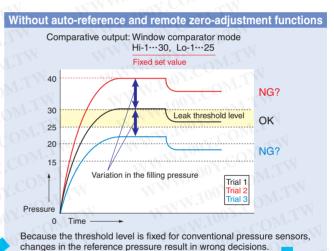

With auto-reference function applied Comparative output: Window comparator mode Hi-1···0, Lo-1··· - 5 Sets the absolute threshold level Auto-reference input The display remains at '30' and only the threshold level is changed 30 25 20 Threshold level after applying auto-reference input 15 Threshold level before applying auto-reference input Trial 1 Pressure Auto-reference input value -5Time When auto-reference input is applied, the reference pressure '30' is added to the threshold level. If the reference pressure changes to '20' or '40', the

auto-reference input compensates for this every time by changing the

WWW.100Y.COM

threshold level, so any variation in the filling pressure can be ignored.

With remote zero-adjustment function applie Comparative output: Window comparator mode Hi-1···0, Lo-1··· — 5 Sets the absolute threshold level The display is forced to '0', and only the filling pressure drop range is displayed. 30 OK 25 20 Threshold level after applying remote zero-adjustment input 15 Threshold level before applying remote zero-adjustment input Trial 1 Pressure 0 Displayed when remote zeroadjustment input is applied--5

Other useful functions

Sub display can be customized

The sub display can be set to indicate any other desired values or letters apart from the threshold value. This eliminates the need for tasks such as affixing a label to the device to indicate the normal pressure value.



Setting details can be understood at a glance

The **DP-100** setting details appear in the digital display. Because the settings are in numeric form that can be easily understood, it is useful for times such as when receiving technical support by telephone.




Peak hold and Bottom hold functions

The peak values and bottom values for fluctuating pressures can be displayed using the dual display.



Response time can be changed

The response time can be changed in 10 levels from 2.5 ms to 5,000 ms. This prevents chattering and incorrect operation due to sudden changes in pressure.

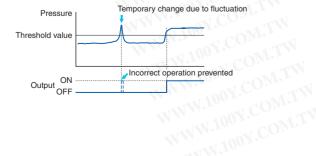

Energy-saving design! Equipped with an ECO mode

This mode lowers the display luminance to cut power consumption by approximately 30 %. The displays can also be turned off completely to achieve a power saving of approximately 40 %.



Display refresh rate can be varied


The display refresh rate for the digital displays can be changed to one of three settings: 250 ms, 500 ms or 1,000 ms. Flickering of the display can be reduced by making the display refresh rate longer.

Installation is also easy!

Tight installation to panels is possible

An exclusive mounting bracket that is suitable for 1 to 6 mm 0.039 to 0.236 in panel thickness is available.



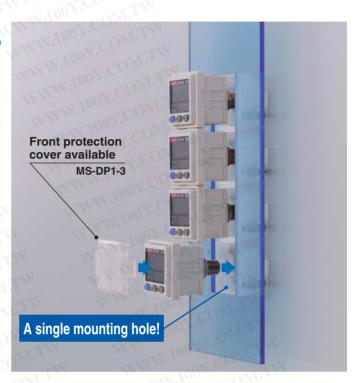

• An exclusive mounting bracket (MS-DP1-1) that supports tight installation is available



Cable can be connected with one-touch connection

The accessory connector attached cable (2 m $6.562~{\rm ft}$) can be connected easily with one-touch connection.



※ Options: 1 m 3.281 ft / 3 m 9.843 ft / 5 m 16.404 ft types are also available. Types without connector attached cable are also available



Commercially-available connectors can be used for cable connections. Only the required length of cable needs to be used, which contributes to a reduced amount of wastage for unneeded cable.



ORDER GUIDE

	Тур	oe .	Appearance	Rated pressure range	Model No.	Pressure port	Comparative output
O	VI.I.	For low pressure	Ton COMP	- 100.0 to + 100.0 kPa	DP-101	W	
an	Standard	For high pressure		-0.100 to +1.000 MPa	DP-102	M5 female thread +	
Asian	WI.Mo	For low pressure		- 100.0 to + 100.0 kPa	DP-101A	R (PT) 1/8 male thread	NPN open-collector transistor
	Multi-function	For high pressure		-0.100 to +1.000 MPa	DP-102A	male tillead	
V.	COM	For low pressure	The state of the s	- 100.0 to + 100.0 kPa	DP-101-E-P	M.T.W	
European	Standard	For high pressure		-0.100 to +1.000 MPa	DP-102-E-P	M5 female thread +	
nrop	TCOM.	For low pressure	-500	- 100.0 to + 100.0 kPa	DP-101A-E-P	G ¹ / ₈ male thread	PNP open-collector transistor
70	Multi-function	For high pressure		-0.100 to +1.000 MPa	DP-102A-E-P	ST CO	
10	101.	TW	W 1001.	100 0 to 1 100 0 1/D-	DP-101-N	COM	NPN open-collector transistor
	Otanaland	For low pressure		- 100.0 to + 100.0 kPa	DP-101-N-P	OM.T	PNP open-collector transistor
an	Standard	WELL	%CN-14A-C2 /Connector attached\	- 0.100 to + 1.000 MPa	DP-102-N	001.CM	NPN open-collector transistor
meric	· Too CO	For high pressure	cable 2 m 6.562 ft	- 0.100 to + 1.000 MPa	DP-102-N-P	M5 female thread +	PNP open-collector transistor
North American	N.100	ONT.	is attached.	100.0 +- 1.100.0 HP-	DP-101A-N	NPT ¹ / ₈ male thread	NPN open-collector transistor
Nor	11007.	For low pressure		- 100.0 to + 100.0 kPa	DP-101A-N-P	Name uncad	PNP open-collector transistor
	Multi-function	For high pressure		-0.100 to +1.000 MPa	DP-102A-N	W.100 1. CC	NPN open-collector transistor
	N 1100	For high pressure		- 0.100 to + 1.000 MPa	DP-102A-N-P	100Y.	PNP open-collector transistor

Types without connector attached cable

Types without connector attached cable are available. When ordering this type, add '-J' at the end of the Model No. WW.100Y.COM.TW Model No: DP-101-J, DP-101-E-P-J, DP-101-N-J, DP-101-N-P-J

DP-102-J, DP-102-E-P-J, DP-102-N-J, DP-102-N-P-J

Accessory


CN-14A-C2 (Connector attached cable 2 m 6.562 ft)



OPTIONS


	CN-14A-C1	1 m 3.281 ft	0.2 mm ² 4-core cabtyre cable	
Connector attached cable	CN-14A-C3	3 m 9.843 ft	with connector on one end	
attached cable	CN-14A-C5	5 m 16.404 ft	Cable outer diameter: φ3.7 mm φ0.146 in	
Connector	CN-14A On the market soon	Set of 10 hous	ings and 40 contacts	
Sensor mounting bracket	MS-DP1-1		to be installed to face in the direction of the Multiple sensors can also be mounted closely	
Panel mounting bracket	MS-DP1-2	Allows installat 0.039 to 0.236	ion to panels with thickness of 1 to 6 mm in.	
Front protection cover	MS-DP1-3		ljustment surfaces of sensors. ed when using the panel mounting bracket)	

Sensor mounting bracket

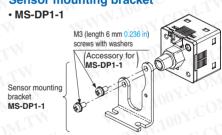

Panel mounting bracket, Front protection cover

- MS-DP1-2
- MS-DP1-3

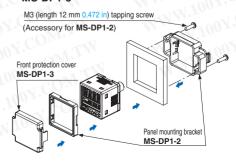

SPECIFICATIONS

		Туре	Stand	· · · · · · · · · · · · · · · · · · ·	2011	unction
	- M	WW	For low pressure	For high pressure	For low pressure	For high pressure
M.	Model No.	Asian	DP-101	DP-102	DP-101A	DP-102A
	ge /	European	DP-101-E-P	DP-102-E-P	DP-101A-E-P	DP-102A-E-P
Item	Δ	North American (Note 2)	DP-101-N(-P)	DP-102-N(-P)	DP-101A-N(-P)	DP-102A-N(-P)
Туре	of pressure	9	MM. TO COME	Gauge	pressure	
Rate	d pressure	range	- 100.0 to + 100.0 kPa	-0.100 to +1.000 MPa	- 100.0 to + 100.0 kPa	-0.100 to +1.000 MPa
Set p	oressure rar	nge	- 100.0 to + 100.0 kPa (- 1.020 to + 1.020 kgf/cm² (- 1.000 to + 1.000 bar (- 14.50 to + 14.50 psi (- 750 to + 750 mmHg (- 29.5 to 29.5 inHg	- 0.100 to + 1.000 MPa (-100 to + 1,000 kPa (-1.02 to + 10.20 kgf/cm² (-1.00 to + 10.00 bar (-1.60 to + 145.0 psi	- 100.0 to + 100.0 kPa (- 1.020 to + 1.020 kgf/cm²) - 1.000 to + 1.000 bar (- 14.50 to + 14.50 psi) - 750 to + 750 mmHg - 29.5 to 29.5 inHg	-0.100 to +1.000 MPa -100 to +1,000 kPa -1.02 to +10.20 kgf/cm ² -1.00 to +10.00 bar -14.6 to +145.0 psi
Press	sure withsta	andability	500 kPa	1.5 MPa	500 kPa	1.5 MPa
Appli	cable fluid	V.r.	100 x	Non-cor	rosive gas	
Selec	ctable unit	WILL	For low pressure: F	«Pa, kgf/cm², bar, psi, mmHg, i	nHg, For high pressure: MPa, kP	a, kgf/cm², bar, psi
Supp	ly voltage	TV	WWW. OX.C		Ripple P-P 10 % or less	, , , , , , , , , , , , , , , , , , , ,
N.J.	er consump	tion	ECO mode: 600	n: 840 mW or less (Current con mW or less at STD (Current co	sumption 35 mA or less at 24 V sonsumption 25 mA or less at 24 V sonsumption 20 mA or less at 24 V onsumption 20 mA or less at 24	supply voltage)
Comp	parative ou	tput	<asian, (npn="" american="" north="" o<br="">NPN open-collector transistor • Maximum sink current: 100 r • Applied voltage: 30 V DC or less (br • Residual voltage: 2 V or less</asian,>	nA etween comparative output and 0 V)		W.T.
M	Output ope	ration	The state of the s	NO / NC (selectab	ole by key operation)	CO_{M-1}
1	Output mod	les	IN MM.	EASY mode / Hysteresis mo	de / Window comparator mode	
1	Hysteresis	CON	THE WAY	Minimum 1 digit (variable) (how	ever, 2 digits when using psi unit	
	Repeatabili	ty	\pm 0.1 % F.S. (within \pm 2 digits)	\pm 0.2 % F.S. (within \pm 2 digits)	\pm 0.1 % F.S. (within \pm 2 digits)	\pm 0.2 % F.S. (within \pm 2 digits
-	Response t	- 001			500 ms, 1,000 ms, 5,000 ms, sele	- 1/1
H		t protection	2.5 116, 5 116, 15 116, 25	The state of the s	porated	octable by key operation
	SHOIT-CITCUI	t protection	OM.I	N () () ()		
Auto	rnal input o-reference note zero-a ction		CONTAIN N	WWW.100X.COM	ON voltage: 0.4 V DC or less OFF voltage: 5 to 30 V DC, or open Input impedance: 10 k Ω approx.	
Analo	og voltage o	output	Y.COM.TW	M.M. 100 X. CO.	Output voltage: 1 to 5 V DC Zero point: within 3 V \pm 5 % F.S. Span: within 4 V \pm 5 % F.S. Linearity: within \pm 1 % F.S. Output impedance: 1 k Ω approx.	Output voltage: 0.6 to 5 V Zero point: within 1 V \pm 5 % F.S. Span: within 4.4 V \pm 5 % F.S. Linearity: within \pm 1 % F.S. Output impedance: 1 k Ω approximately
Displ	ay	MM			ate: 250 ms, 500 ms, 1,000 ms, s	
1	Displayable	pressure range	- 100.0 to + 100.0 kPa (- 1.020 to + 1.020 kgf/cm²) - 1.000 to + 1.000 bar (- 14.50 to + 14.50 psi - 750 to + 750 mmHg - 29.5 to 29.5 inHg	- 0.100 to + 1.000 MPa (-100 to + 1,000 kPa (-1.02 to + 10.20 kgf/cm² (-1.00 to + 10.00 bar (-14.6 to + 145.0 psi	100.0 to +100.0 kPa (-1.020 to +1.020 kgf/cm²) 1.000 to +1.000 bar (-14.50 to +14.50 psi) 750 to +750 mmHg (-29.5 to 29.5 inHg	-0.100 to +1.000 MPa -100 to +1,000 kPa -1.02 to +10.20 kgf/cm ² -1.00 to +10.00 bar -14.6 to +145.0 psi
Indica	ator	M _A		comparative output 2 operation indicator: 1	Orang (Comparative output 1 operation indicator: Analog voltage output operation indicator:	
ا ۾	Pollution de	gree	MAN TO THE TANK	IP40	(IEC)	WW 1007.0
resistance	Ambient ter	mperature	— 10 to	+50 °C + 14 to + 122 °F, Sto	orage: -10 to +60 °C +14 to	+ 140 °F
esis	Ambient hu	midity	35 to 85	% RH (No dew condensation	or icing allowed), Storage: 35 to 8	85 % RH
	Voltage with	nstandability	1,000 V AC	for one min. between all supply	terminals connected together ar	nd enclosure
_ ₽ ⊢	nsulation re		STATE CONT		Il supply terminals connected too	
ig '	Vibration re		100	00	is mounted: 10 to 150 Hz frequency, 0.75 mm 0.030 in	- 111
			A A A A A A A A A A A A A A A A A A A	- 11 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	-10011 + 1	
	Shock resis		3111		X, Y and Z directions for three tir	
		aracteristics			Within ± 0.5 % F.S. (at +20 °C +68 °F)	
	sure port		1 100		d + G ¹ / ₈ male thread, North American: N	
Mate	rial		Enclosure: PBT (glass fiber reinforced), LC	D display: Acrylic, Pressure port: Brass (n	ickel plated), Mounting threaded part: Brass	(nickel plated), Switch part: Silicone rubb
Conr	necting met	hod	WW.luc	CON Con	nector	
Cable	e extension		Extension up to total 100 m 328.08	34 ft (less than 10 m 32.808 ft who	en conforming to CE marking) is pos	ssible with 0.3 mm ² , or more, cab
Weig	ht		MM 1100	Net weight: 40 g approx.,	Gross weight: 135 g approx.	
	ssories		TWW.	CN-14A-C2 (Connector atta	ched cable 2 m 6.562 ft): 1pc.	


Notes: 1) Where measurement conditions have not been specified precisely, the conditions used were ambient temperature +20 °C +68 °F.

2) Model Nos. of North American standard type having the suffix '-P'


are PNP output type.

I/O CIRCUIT AND WIRING DIAGRAMS

NPN output type

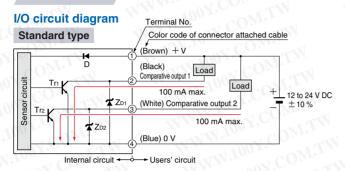


Symbols ... D : Reverse supply polarity protection diode Z_{D1} , Z_{D2} : Surge absorption zener diode Tr1, Tr2: NPN output transistor

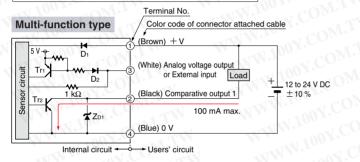

Symbols ... D1, D2: Reverse supply polarity protection diode Z_{D1}: Surge absorption zener diode T_{r1}: PNP input transistor


Tr2: NPN output transistor

Terminal arrangement diagram

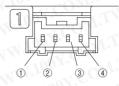


Terminal	Designation
1	+ V
2	Comparative output 1
3	Standard type: Comparative output 2 Multi-function type: Analog voltage output or External input
4	0 V
IN M	WWW.100X.COM.TW WWW.100X.COM.TW

PNP output type

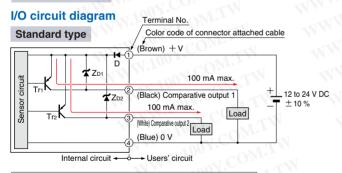


Symbols \dots D : Reverse supply polarity protection diode Z_{D1} , Z_{D2} : Surge absorption zener diode T_{r1} , T_{r2} : PNP output transistor

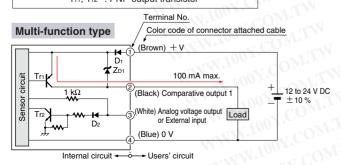

Symbols ... D1, D2: Reverse supply polarity protection diode ZD1: Surge absorption zener diode Tr1: PNP output transistor Tr2: NPN input transistor

Terminal arrangement diagram

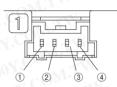

erminal	Designation
1	+v +v COM
2	Comparative output 1
3	Standard type: Comparative output 2 Multi-function type: Analog voltage output or External input
4	ON OV

PRECAUTIONS FOR PROPER USE



 Never use this product as a sensing device for personnel protection.

 In case of using sensing devices for personnel protection, use products which meet regulations and standards, such as OSHA, ANSI or IEC etc., for personnel protection applicable in each region or country.

 The DP-100 series is designed for use with noncorrosive gas. It cannot be used with liquid or corrosive gas.

Wiring

- · Make sure that the power supply is off while wiring
- · Verify that the supply voltage variation is within the rating
- If power is supplied from a commercial switching regulator, ensure that the frame ground (F.G.) terminal of the power supply is connected to an actual ground.
- In case noise generating equipment (switching regulator, inverter motor, etc.) is used in the vicinity of this sensor, connect the frame ground (F.G.) terminal of the equipment to an actual ground.
- Do not run the wires together with high-voltage lines or power lines or put them in the same raceway. This can cause malfunction due to induction.
- · Incorrect wiring will cause problems with operation.

Connection

 Do not apply stress directly to the connection cable leader or to the connector.



Conditions in use for CE conformity


 The DP-100 series is a CE conformity product complying with EMC Directive. The harmonized standard with regard to immunity that applies to this product is EN 61000-6-2 and the following condition must be met to conform to that standard.

Condition


 The sensor should be connected less than 10 m 32.808 ft from the power supply.

Mounting

• The MS-DP1-1 sensor mounting bracket is available separately, and it should be used for mounting. When tightening the sensor to the sensor mounting bracket, use a tightening torque of 0.5 N·m or less.

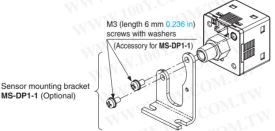

• The MS-DP1-2 panel mounting bracket (optional) and the MS-DP1-3 front protection cover (optional) are also available.

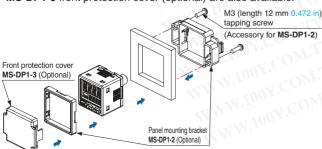

Piping

• If connecting a commercially-available coupling to the pressure port, attach a 12 mm 0.472 in spanner (14 mm 0.551 in spanner for DP-100-E type) to the hexagonal section of the pressure port to secure it, and tighten at a torque of 9.8 N·m or less. If it is tightened using excessive torque, it may damage the coupling or the pressure port. In addition, wrap sealing tape around the coupling when connecting it to prevent leaks.



Others

- · Use within the rated pressure range.
- Do not apply pressure exceeding the pressure withstandability value. The diaphragm will get damaged and correct operation shall not be maintained.
- Do not use during the initial transient time (0.5 sec. approx.) after the power supply is switched on.
- · Avoid dust, dirt, and steam,
- Take care that the sensor does not come in direct contact with water, oil, grease, or organic solvents, such as, thinner, etc.
- Do not insert wires, etc., into the pressure port. The diaphragm will get damaged and correct operation shall not be maintained.
- · Do not operate the keys with pointed or sharp objects.

RUN mode

· This is the normal operating mode.

Setting item	Description
Threshold value setting	The threshold values for ON / OFF operation can be changed directly by pressing the increment key (UP) and the decrement key (DOWN).
Zero-adjustment function	This forces the pressure value display to be reset to zero when the pressure port is open on the atmospheric pressure side.
Key lock function	Stops key operations from being accepted.
Peak hold / bottom hold function	Displays the peak value and bottom value for fluctuating pressure. The peak value appears in the main display, and the bottom value appears in the sub display.

MENU SETTING mode

- If the mode selection key is pressed and held for 2 seconds in RUN mode, the mode will switch to MENU SETTING mode.
- If the mode selection key is pressed while a setting is being made, the mode will switch to RUN mode. In this case, the settings that have been changed will be entered.

Setting item	Description
Comparative output 1 output mode setting	Sets the output mode for comparative output 1.
Comparative output 2 output mode setting (standard type only)	Sets the output mode for comparative output 2.
Analog voltage output / external input switching (multi-function type only)	Allows switching between analog voltage output and auto-reference input / remote zero-adjustment input.
NO / NC switching	Sets normally open (NO) or normally closed (NC)
Response time setting	Sets the response time. The response time can be selected from 2.5 ms, 5 ms, 10 ms, 25 ms, 50 ms, 100 ms, 250 ms, 500 ms, 1,000 ms and 5,000 ms.
Display color switching for main display	Allows the color for the main display to be changed. The colors can be set to 'red / green' or 'green / red' to correspond to ON / OFF output, or it can be fixed at 'red' or 'green' all the time.
Unit switching	Pressure unit can be changed.



PRECAUTIONS FOR PROPER USE

PRO mode

- If the mode selection key is pressed and held for 5 seconds in RUN mode, the mode will switch to PRO mode.
- If the mode selection key is pressed while a setting is being made, the mode will switch to RUN mode. In this case, the settings that have been changed will be entered.

Setting item	Description
Sub display switching	Changes the information in the sub display during RUN mode operation to the desired alphanumeric display.
Display refresh rate switching	Changes the display refresh rate for the pressure value displayed in the main display.
Hysteresis fix value switching	Sets the response time for EASY mode and window comparator mode. (8 steps)
Linked display color switching (standard type only)	Allows the display color for the main display to be switched in line with the output operation for comparative output 1 or comparative output 2.
ECO mode setting	Allows power consumption to be reduced by dimming the display or turning it off.
Setting check code	Allows the setting details to be checked via codes.
Setting copy mode	Allows the setting details for the master sensor to be copied to slave sensors.
Reset setting	Resets the settings to the factory settings.


Table of codes

	. 0		-11	2nd digit			4th	digit
Code	1st	digit		rd type	Multi-function type	3rd digit		Standar type onl
O	Comparative output 1 output mode	NO / NC switching	Comparative output 2 output mode	NO / NC switching	Analog voltage output / External input	Threshold value display	Display color for main display	Display color linkin
0	EASY	NO	OFF	OFF	Analog voltage output	P-1, Lo-1	Red	Comparativoutput 1
1	LAGI	NC	EASY	NO	Auto- reference	Hi-1	when ON	Comparativ output 2
2	Hysteresis	NO	Y.C	NC	Remote zero-adjustment	P-2, Lo-2	Green	Comparativoutput 1
3	пуѕієтеѕіѕ	NC	001.C	NO	TW	Hi-2	when ON	Comparativ output 2
Ч	Window	NO	Hysteresis	NC	L.TY	ADJ.	Always	Comparativ output 1
5	comparator	NC	Window	NO	MITY	N	red	Comparativ output 2
5		11/1/	comparator	NC	OMI		Always	Comparativ output 1
7			VAT'	5	$G_{M_{I}}$	- T N	green	Comparativ
1				002.	cov	5		output 2
T II M	N TW TW						N	output 2
epc		digit	6th	digit	7th	digit		digit
Code	Respon	se time	Unit sw	digit	7th Display re	eflesh rate	ECO	digit mode
0	Respon 2.	se time 5 ms	Unit sw MI	digit itching Pa	7th Display re 25	eflesh rate 0 ms	ECO OI	digit mode FF
0	Respon 2.5	se time 5 ms 5 ms	Unit sw MI kF	digit itching Pa	7th Display re 250 500	eflesh rate 0 ms 0 ms	ECO OI ST	digit mode FF
0	Respon 2.5	se time 5 ms 5 ms 0 ms	Unit sw MI kF kgf/	digit itching Pa cm ²	7th Display re 250 500	eflesh rate 0 ms	ECO OI ST	digit mode FF
0	2.5 2.5 10 2.5	se time 5 ms 5 ms 0 ms 5 ms	Unit sw MI kF kgf/	digit digit itching Pa Pa cm²	7th Display re 250 500	eflesh rate 0 ms 0 ms	ECO OI ST	digit mode FF
0	Respon 2.8 10 28 50	se time 5 ms 5 ms 0 ms	Unit sw MI kF kgf/	digit itching Pa Pa cm² ar si	7th Display re 250 500	eflesh rate 0 ms 0 ms	ECO OI ST	digit mode FF


DIMENSIONS (Unit: mm in)

The CAD data in the dimensions can be downloaded from the SUNX website: http://www.sunx.co.jp/


500 ms 1,000 ms 5,000 ms

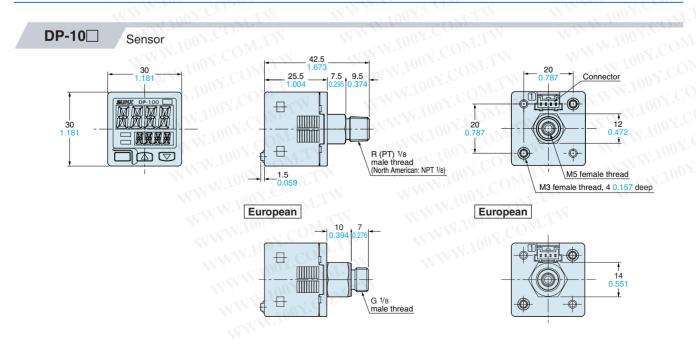


MS-DP1-1 Sensor mounting bracket (Optional)

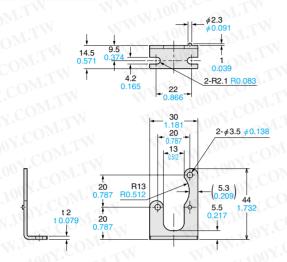


Assembly dimensions

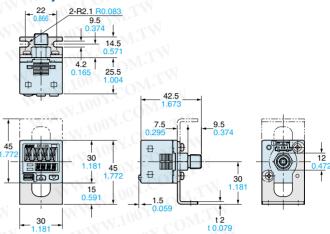


MS-DP1-2 MS-DP1-3 Panel mounting bracket (Optional), Front protection cover (Optional)

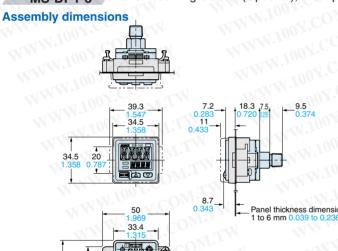

Panel cut-out dimensions

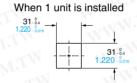


When 'n' units are installed horizontally in series When 'n' units are installed vertically in series

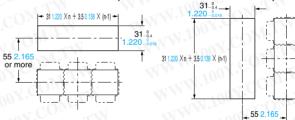

Note: The panel thickness should be 1 to 6 mm 0.039 to 0.236 in.

Note: The panel thickness should be 1 to 6 mm 0.039 to 0.236 in.

CN-14A-C Connector attached cable (Optional, CN-14A-C2 is attached to the sensor)

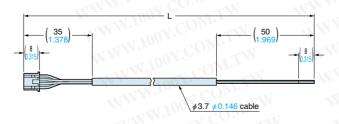

	Cable length (mm, in)
CN-14A-C1	1,000 39.370
CN-14A-C2	2,000 78.740
CN-14A-C3	3,000 118.110
CN-14A-C5	5,000 196.850

Compact Size • 2-color Digital Display DP4 SERIES

New shape makes it most suitable for panel installation

Light-weight, compact design

compact form specifically designed for mounting on an equipment panel. It only uses half the space of our conventional product and provides the lightest weight of just 30 g (cable excluded).



Bright, easy to view twocolor digital display

The digital display is a large, easy-to-view, and two-color digital display. It is also functions as an output indicator as it changes from green to red color when the output turns ON, enabling you confirm the output status at a glance.

Supplied with a simple-tomount panel mounting bracket

A panel mounting bracket (MS-DP-1) is enclosed to enable simple mounting of the sensor onto the panel surface, thus contributing to the total cost reduction.



: **DP4-50/50P** 0 to - 101.3 kPa **DP4-52/52P** 0 to 1.000 MPa **DP4-57/57P** - 100.0 to 100.0 kPa

Applicable fluid: Non-corrosive gas Supply voltage: 12 to 24 V DC $^{+\,10}_{-\,15}$ % Output: **DP4-5** NPN open-collector transistor

DP4-5 P PNP open-collector transistor
Pressure port: M5 female thread Dimensions: W40 × H20 × D49 mm

Head-separated Type • 2-color Digital Display DP5 SERIES Controller DPH SERIES Sensor head

1/1,000 second high-speed response!

Response time 1 ms

Mounting the detachable head close to the detecting section minimizes piping and enables response time of 1 ms, as well as greatly decreasing tact time delay. In addition, the ultra-small and light-weight design of the head means it can easily be mounted on moving sections.

Sensor head with operation indicator

The sensor head is also equipped with

operation indicator. Output ON / OFF can be checked on the sensor head, so that it is suitable for checking operation at the suction head.



特力材料886-3-5753170 胜特力电子(上海) 86-21-34970699 胜特力电子(深圳) 86-755-83298787 Http://www.100y.com.tw

Independent use of sensor head possible

Light-weight, compact design

The controller inherits its lightweight, compact design from the popular DP4 series of digital pressure sensors. Control panel setup is low cost and requires minimal space.

Convenient intermediate cable with connector

Intermediate cable with connectors for connecting the sensor head and the controller makes operation maintenance easier

Note: An intermediate cable is required to connect the controller and the sensor head. Please order the intermediate cable with connector separately



Pressure sensor heads

Rated pressure range: **DPH-A**□0 0 to − 101.3 kPa **DPH-A**□2 0 to 1.000 MPa **DPH-A**□7 − 100.0 to 100.0 kPa

Applicable fluid: Non-corrosive gas Supply voltage: 12 to 24 V DC $^{+10}_{-15}$ % Analog voltage output: 1 to 5 V

(over rated pressure range)
Pressure port: **DPH-A0**□ M5 male thread, DPH-A1□ R (PT) 1/8 male thread / M5 female thread

DPH-A2 NPT 1/8 male thread / 10-32UNF female thread DPH-A30 10-32UNF male thread Dimensions: DPH-A0 /A30 12.5 × 25 × 20 mm **DPH-A1**□/**A2**□ 12.5 × 25 × 25 mm

Pressure sensor controllers

Applicable pressure sensor head: DPH-A Rated pressure range: Vacuum pressure 0 to - 101.3 kPa

Positive pressure 0 to 1.000 MPa Compound pressure - 100.0 to 100.0 kPa

Supply voltage: 12 to 24V DC $^{+10}_{-15}\%$ Comparative Output (Comparative output 1, Comparative output 2):

DP5-C NPN open-collector transistor
DP5-C-P PNP open-collector transistor
Analog voltage output: 1 to 5 V DC (over rated pressure range)
Dimensions: W40 × H20 × D43 mm

All information is subject to change without prior notice.



http://www.sunx.co.jp/

SUNX Limited

2431-1 Ushiyama-cho, Kasugai-shi, Aichi, 486-0901 Japan Phone: +81-(0)568-33-7211 FAX: +81-(0)568-33-2631

Overseas Sales Dept.

Phone: +81-(0)568-33-7861 FAX: +81-(0)568-33-8591