

DS2 Series ~Economical Digital Force Gauge~

Simple function digital force gauge Suitable for checking peak value by digital

Ideal for hand-use force measurement due to the lightweight and the easy grip design.

♦ Displayed in digital.

Reading value is easier than in analogue type.

♦Reversible display


The display can be reversed by easy button operation.



♦OK/NG Judgment

Easy to check OK or NG value by setting upper and lower limit

-NG ~under the lower limit~



Displayed value < lower limit


OK ~between upper and lower limit~



Lower limit< Displayed value< Upper value

+NG ~ over the upper limit

Upper limit < Displayed value

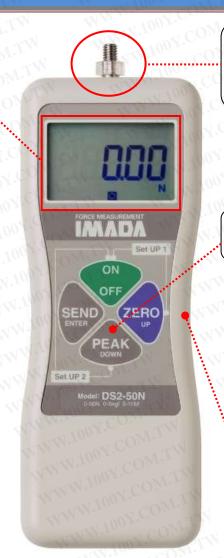

Measuring various tension/compression force by installing an attachment.

It is only one push to turn on peak hold mode.

The easy-grip design helps stable measurement.

[6 included attachments]

Simple tension/compression measurement are possible with included attachments below

Small hook A-1(S-1)(SR-1)	Disk shaped A-2(S-2)	Conical shaped A-3(S-3)	Chisel tip A-4(S-4)	Notched tip A-5(S-5)	Extension rod A-6(S-6)
3	SWAN TO THE PART OF THE PART O	100 X CONTAN 100 X ONTAN 100 X ONTAN 11 X ONTAN	M. 100 M. 100 M. 100 M. 100 M.	COMPAN COMPAN	WWW. JOOY.CO.

^{*}A type (made of aluminum) is included in 100N or less capacity force gauges, S type (made of steel) is included for in 200N to 1000N capacity force gauges.

^{*}SR-1 is including for 1000N capacity.

FORCE MEASUREMENT

Application

Using with a test stand and a software helps

Effective and Accurate

Measurement /Data management

The test stand enables to set measurement condition uniform. The transferred data to PC can be saved easily and precisely

with the software.



*Connection cable CB-203 is required for using ZLNK3.

[DS2 Series specifications]

[DOZ Genes specin	carional	
Model	DS2 Series	
Accuracy	±0.2%F.S.±1digit	
Unit of measurement	N NWW.100Y.COM.TW NWW.100Y.COM.TW	
Display update	4-digit LCD	
Sampling rate	1000 data/sec. (Max.)	
Battery	10 hours (Full charge for 10 hours)	
Safe overload rating	Approx. 200% F.S.	
Power	Rechargeable NiMH battery pack, AC adapter	
Operating environment	Temperature: 0 to +40 degree Celsius Humidity: 20 -80%RH	
Functions	Peak hold (tension and compression)/ Comparator(judgment of acceptance or rejection)/ Reversible display / Dumping (2 Levels)	
Output	RS232C/Mitutoyo digimatic (*1) /Analog(+/- 1V F.S.)	
Overload warning	Approx.110% F.S.(Display flashing)	
External connecting switch	SEND (a point of contact holding) / Zero reset/Peak ON/OFF setting	
Weight	Approx. 420g (*2)	
Dimensions	Please refer to dimensions	
Accessory	AC adapter/ Inspection certificate/Carrying case/ Attachments (Included attachments depend on the force gage range.)	

^{*1} NOT always available for Mitutoyo digimatic products.

[DS2 Available models]


Model	Capacity	Display	Resolution	Thread	Including attachment
DS2-2N	2N	2.000N	0.001N	TW	WWW.100Y.C
DS2-5N	5N	5.000N	0.001N	MIL	A4 AC
DS2-20N	20N	20.00N	0.01N	OM	A1~A6
DS2-50N	50N	50.00N	0.01N	M6	
DS2-200N	200N	200.0N	0.1N		
DS2-500N	500N	500.0N	0.1N		(SR-1) S1~S6
DS2-1000N	1000N	1000N	1N		

^{*2} The weight is slightly different depending on the range.

[Related Products]



Graphing Software: ZLINK3

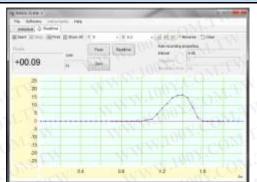

Main Features of ZLINK3

- Force-time graph is able to be drawn at Max 50 times per
- Captured data can be saved as CSV file.
- *Please refer to ZLINK3 specification if necessary.
 *RS232C cable B-203 is necessary to connect DS2 series and PC(PC side connector is 25P male B-201,25P female CB-202 as well).

Handle: FOH-1

Standard model digital force gauge ZTS series

Standard model for reproducible measurement. Data management is easy due to USB connecting with PC.




ZTS Series

The main features of ZTS

- 1) Useful and clear display.
- 2 Reproducible high speed sampling enables to capture peak value precisely.
- ③ Easy data management by included software "ZT-Logger".
- 4 Multiple functions for improving the usability of various situations.

*Please refer to ZTS specification if necessary.

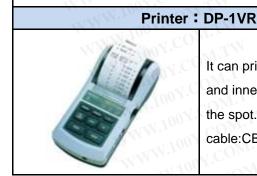

It can print displayed value and inner memory data on the spot. (Required cable:CB-301)




Strong force is able to apply stably at using a force gauge by hands.

[Related Cables]

Model	Description	Purpose of use
CB-101	Analogue cable	Connecting multi-meter or oscilloscope
CB-203	RS232C Cable(9P)	Connecting PC using ZLINK3
CB-201	RS232C Cable(25P male)	Connecting PC using ZLINK3
CB-202	RS232C Cable(25P female)	Connecting PC using ZLINK3
CB-301	Digimatic Cable	Connecting Printer DP-1VR



[Dimensions]

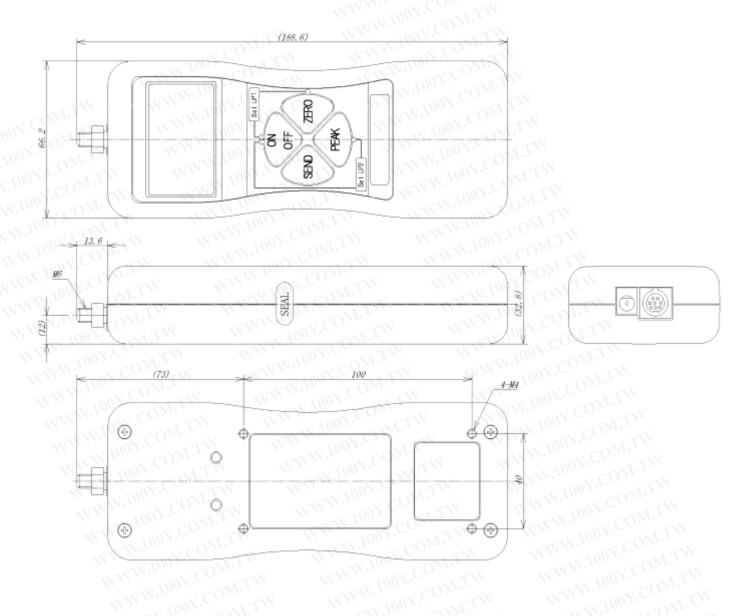

[Calibration Certificate]

- We offer calibration certificate with extra charge.
- We also offer calibration services according to ISO/IEC17025: 2005

[Caution]

- This product is designed for force measurement only. Do not use it for other purpose.
- Do not copy and use this content without authority.
- WWW.100Y.COM.TV - Please note add load over capacity, or add force from side or torsion, its sensor would be broken down. WWW.100Y.COM.T WWW.100Y.COM.
- The contents may be changed without notice in advance.