# TA Series Analog Setting Non-Indicating type, PID Control

# Analog and non-indicating type, PID control, set temperature by dial

# Features

- Improved control performance with built-in microcomputer
- Adopting new Auto-tuning PID control algorithm
  - : Selectable ON/OFF, PID control (with the external slide SW)
- Easy to check controlling status with deviation indicating lamp

Please read "Caution for your safety" in operation manual before using.

- : Deviation LED(red, green), output LED(red) indicator
- Dial setting output OFF function
- Sensor broken display function





# Ordering information

勝 特 力 材 料 886-3-5753170 胜特力电子(上海) 86-21-34970699 胜特力电子(深圳) 86-755-83298787 Http://www.100y.com.tw

R C Celsius °C Fahrenheit °F Temperature sensor -50 to 100 -58 to 212 0 to 100 32 to 212 Pt K 32 to 392 Temperature range 0 to 200 Pt J K for each sensor 0 to 300 32 to 572 J Pt 0 to 400 32 to 752 J Κ 6 0 to 600 32 to 1.112 K 0 to 800 32 to 1,472 Κ 32 to 2,192 K 0 to 1,200 DPt100Ω Sensor input type J(IC) K K(CA) Control output R Relay output S SSR drive voltage output Power supply 4 100-240VAC 50/60Hz Control method В ON/OFF control & PID control combined S DIN W48 x H48mm(8pin plug type)\*1 Size М DIN W72 x H72mm DIN W96 x H96mm Item Analog setting type temperature controller

%1: 8pin socket(PG-08, PS-08) is sold separately.

(A) Photo electric

(B) Fiber optic

NEW

(C) Door/Area sensor

(D) Proximity sensor

(E) Pressure

> (F) Rotary

(G) Connector/

(H) Temp. controller

> (I) SSR/ Power controller

Counter

mer

Panel meter (M)

(M) Tacho/ Speed/ Pulse meter

(O) Sensor

(P) Switching mode power supply

(Q) Stepper motor& Driver&Controller

(R) Graphic/ Logic panel

(S) Field network device

> T) Software

(U) Other

Autonics H-67

# Specifications


Series		TAS	TAM	TAL			
Power s	supply	100-240VAC 50/60Hz	11, 21 100.	-OM.TV			
Allowab	le voltage range	90 to 110% of rated volta	age	.Co. TW			
Power c	consumption	Max. 4VA	N MW. 100	V.CONT.			
Size		DIN W48×H48mm	DIN W72×H72mm	DIN W96×H96mm			
Display method		Deviation LED(red, green), Output LED(red)					
Setting type		Dial setting Dial setting					
Setting accuracy *1		F.S. ±2% (room temperature 23°C±5°C)					
nput	RTD	DPt100 $\Omega$ (allowable line resistance max. 5 $\Omega$ per a wire)					
type	Thermocouples	K(CA), J(IC)					
20 M	ON/OFF Control	Hysteresis: 2°C fixed					
Control	PID Control	Control period: Relay output - 20 sec. / SSR drive voltage output - 2 sec.					
Control	Relay	250VAC 3A 1c					
output	SSR	12VDC±2V 20mA Max.					
Functions		PV deviation indicatable, Error indicatable					
Dielectric strength		2,000VAC 50/60Hz for 1min.(between input terminal and power terminal)					
Vibration		0.75mm amplitude at frequency of 5 to 55Hz(for 1 min.) in each of X, Y, Z directions for 2 hours					
Relay	Mechanical	Min. 10,000,000 operations(18,000 operations/hr)					
life cycle	Electrical	Min. 100,000 operations(900 operations/hr)					
Insulation resistance		Min. 100MΩ(at 500VDC megger)					
Noise resistance		±2kV R-phase, S-phase the square wave noise (pulse width: 1us) by the noise simulator					
Memory retention		Approx. 10 years (when using non-volatile semiconductor memory type)					
Environ- ment	Ambient temperature	-10 to 50°C, storage: -20 to 60°C					
	Ambient humidity	35 to 85%RH, storage: -35 to 85%RH					
Unit weight		Approx. 65g	Approx. 378g	Approx. 387g			

<sup>%1</sup>: Out of room temperature range: Below 100°C model is F.S.  $\pm4\%$  , Over 100°C model is F.S.  $\pm3\%$ 

# Connections


 $\times$ RTD: DPt100 $\Omega$ (3-wire type)  $\times$ Thermocouple: K(CA), J(IC)

# TAS (XSocket(PG-08, PS-08) is sold separately) **RELAY OUT** 250VAC 3A 1c RESISTIVE LOAD SSR COM 12VDC ±2V N.C 20mA Max. 5 N.O. (6) SENSOR SOURCE: 100-240VAC RTD 4VA 50/60Hz

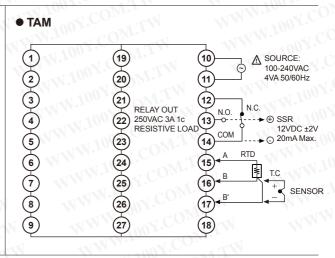

XEnvironment resistance is rated at no freezing or condensation.

# **Analog Setting Non-Indicating type, PID Control**

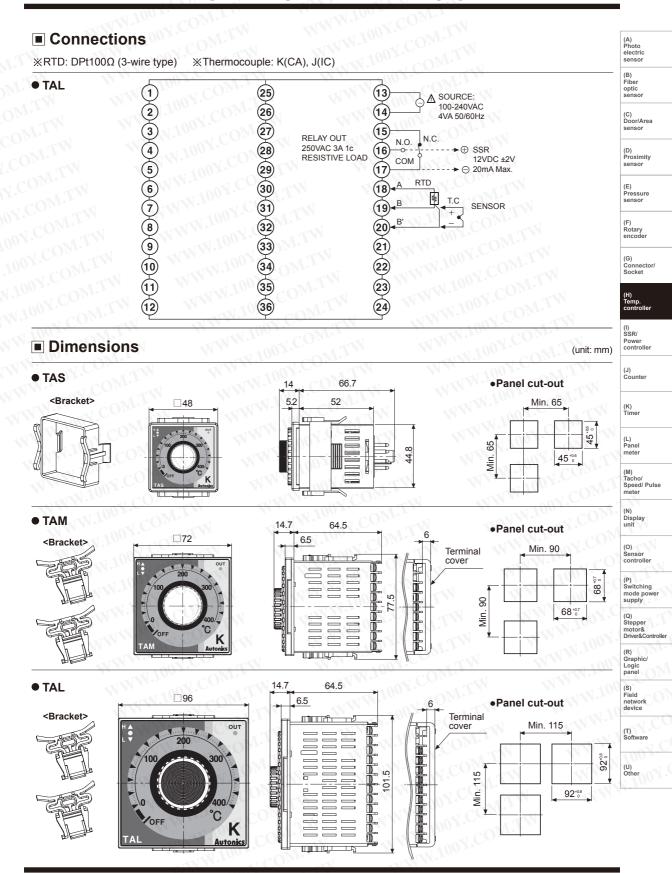

Autonics H-69


# Terminal cover(sold separately)






(unit: mm)

# Parts description

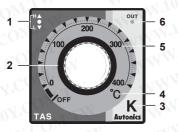

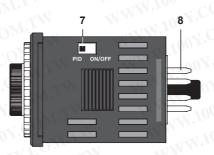

1. Deviation indicator: It shows deviation of present temperature(PV) based on set temperature(SV) by LED.

Input deviation indicator [Deviation indicator: ● (green), ▲/▼(red)]

No	PV deviation temperature	Deviation indicator		No	PV deviation temperature	Deviation	on indicator
1	Input sensor OPEN	<b>▲</b> + ● + ▼	Lamp flash (every 0.5 sec.)	5	Below ±2°C	V.70	Lamp lights
2	Exceed max. input value	<b>A</b>	Lamp flashes (every 0.5 sec.)	6	-2°C to -10°C	●+▼	Lamp light
3	Over 10°C	<b>A</b>	Lamp lights	7	Over -10°C	WY!	Lamp lights
A	2°C to 10°C	<b>A</b> + •	Lamp light	8	Less than min. input value	NAMA.	Lamp flashes (every 0.5 sec.)

XThis is the same as Fahrenheit(°F).

\*When power is on, all lamps light for 2sec., then all lamps turn off and control operation starts.

# 2. Set temperature(SV) dial:

Dial to change set temperature (SV). When changing set temperature, it is applied after 2 sec. for the stable input.

# 3. Input sensor type:

Indicates sensor type of present value. Input sensor type or input range each product is shown in the below table.

Input sensor		Range No.	Temperature range (°C)	Temperature range (°F)
WIN	K(CA)	1	0 to 100	32 to 212
		2	0 to 200	32 to 392
		4	0 to 400	32 to 752
		6	0 to 600	32 to 1,112
Thermocouple		8	0 to 800	32 to 1,472
		C	0 to 1,200	32 to 2,192
		2	0 to 200	32 to 392
	J(IC)	3	0 to 300	32 to 572
		4	0 to 400	32 to 752
	DPt100Ω	0	-50 to 100	-58 to 212
DTD		1	0 to 100	32 to 212
RTD		2	0 to 200	32 to 392
		4 400	0 to 400	32 to 752


- XSet temperature within input range each sensor.
- 4. Temperature unit indicator: Indicates temperature unit(°C, °F) of set temperature(SV) and present value(PV).
- 5. Temperature range indicator: Indicates temperature range of set temperature(SV).
- 6. Control output indicator lamp: Light when control output(Relay output/SSR voltage output).
- 7. Control mode selector switch: Select PID control or ON/OFF control using switch.
- 8. Terminal: Terminals for external connections. For detail, refer to <a> Connections</a>.

H-70

# **Analog Setting Non-Indicating type, PID Control**


# Product mounting


# • TAS(48×48mm) Series

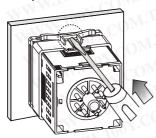

Mount the product on the panel, fasten bracket by pushing with tools as shown above.

## Other Series

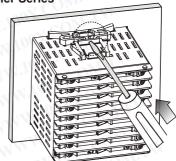

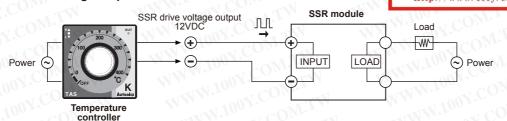

### ON/OFF control

ON/OFF control function is for controlling temperature by comparing present temperature(PV) to setting temperature(SV). ON/OFF control is fixed on reverse operation(Heating).

Output turns on to supply power to heater when present temperature(PV) falls lower than setting temperature(SV) and the output turns off to turn off heater when present temperature(PV) is higher then setting temperature(SV).

XHysteresis is fixed 2°C during ON/OFF control.

# Reverse operation (Heating) Hysteresis Temperature

# PID control

PID constants are suggested and implemented based on self tuning from supply power until reaching set temperature(SV), then self tuning is over after reaching set temperature(SV).

When power supply, in case that set temperature(SV) dial points at OFF or self tuning can not be started because present temperature (PV) is higher than set temperature(SV) or hunting occurs during self tuning, output control is switched to proportion band(P) because that is considered to error. At that time, proportion band is fixed at 10°C.

\*\*Control cycle of PID control and proportion control is 20 sec. in relay output model and 2 sec. in SSR voltage output.

### STOP

Control output could stop without power off by setting the front setting volume to below min. setting range. If control output stops by STOP function, Green lamp in deviation indicator(
) will flash every 1sec.

### Error

Error mark will flash(every 1sec.) in PV indicator when error occurs during the control operation. It will operate normally, if input sensor is connected or returned to normal range.

No	Display	MMM	Description
1	<b>▲</b> + <b>●</b> + <b>▼</b>	Lamp flash	If input sensor line is broken or sensor is not connected.
2	<b>A</b>	Lamp flashes	If measured sensor input is higher than temperature range.
3	▼	Lamp flashes	If measured sensor input is lower than temperature range.

Photo electric sensor

(B) Fiber optic sensor

(C) Door/Area sensor

(D) Proximity sensor

(E) Pressure sensor

> F) Rotary encoder

(G) Connector/ Socket

### (H) Temp. controller

(I) SSR/ Power controller

Counter

imer

(M) Tacho/ Speed/ Pulse

Speed/ Pulse meter

ınit

controller

(P) Switching mode power supply

(Q) Stepper motor& Driver&Controlle

(R) Graphic/ Logic panel

(S) Field network device

(T) Software

(U) Other

Autonics H-71