

TEMP. (Pt 100 ohm) TRANSMITTER


Model : TR-TMP1A4

ISO-9001, CE, IEC1010



Pt 100 ohm
Temp. probe
(Optional)

勝特力材料 886-3-5753170
勝特力电子(上海) 86-21-34970699
勝特力电子(深圳) 86-755-83298787
[Http://www.100y.com.tw](http://www.100y.com.tw)

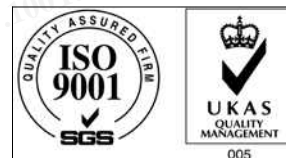

Lutron

LUTRON ELECTRONIC

The Art of Measurement

Temperature (Pt 100 ohm) TRANSMITTER

Model : TR-TMP1A4-400C

Model : TR-TMP1A4-100C

Measure Range	TR-TMP1A4-400C	TR-TMP1A4-100C
	-100 °C to 400 °C	-100 °C to 100 °C
Output	4 - 20 mA	
	TR-TMP1A4-400C	TR-TMP1A4-100C
	-100 °C = 4 mA 0 °C = 7.2 mA 400 °C = 20 mA	-100 °C = 4 mA 0 °C = 12 mA 400 °C = 20 mA
External Adjustment	ZERO VR SPAN VR	
Power Supply	90 - 260 ACV 50 Hz/60 Hz	
Operation Temperature	0 - 50 °C 32 - 122 °F	
Operation Humidity	Less than 80 %RH	
Accessory Included	Pt 100 ohm probe is optional.	
Optional Accessories	Pt 100 ohm temperature probe : TP-100 TP-100A	
Mounting	Din rail or Wall	
Case	ABS plastic	
Others	Four wires connection	

* Appearance and specifications listed in this brochure are subject to change without notice.

勝特力材料 886-3-5753170
 勝特力电子(上海) 86-21-34970699
 勝特力电子(深圳) 86-755-83298787
[Http://www.100y.com.tw](http://www.100y.com.tw)